

# Megohmmeter Models 1050 & 1060



## MEGOHMMETERS

Copyright© Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments. All rights reserved.

No part of this documentation may be reproduced in any form or by any means (including electronic storage and retrieval or translation into any other language) without prior agreement and written consent from Chauvin Arnoux®, Inc., as governed by United States and International copyright laws.

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive • Dover, NH 03820 USA  
Phone: (603) 749-6434 or (800) 343-1391 • Fax: (603) 742-2346

This documentation is provided **as is**, without warranty of any kind, express, implied, or otherwise. Chauvin Arnoux®, Inc. has made every reasonable effort to ensure that this documentation is accurate; but does not warrant the accuracy or completeness of the text, graphics, or other information contained in this documentation. Chauvin Arnoux®, Inc. shall not be liable for any damages, special, indirect, incidental, or inconsequential; including (but not limited to) physical, emotional or monetary damages due to lost revenues or lost profits that may result from the use of this documentation, whether or not the user of the documentation has been advised of the possibility of such damages.

# Statement of Compliance

Chauvin Arnoux<sup>®</sup>, Inc. d.b.a. AEMC<sup>®</sup> Instruments certifies that this instrument has been calibrated using standards and instruments traceable to international standards.

We guarantee that at the time of shipping your instrument has met the instrument's published specifications.

**An NIST traceable certificate may be requested at the time of purchase, or obtained by returning the instrument to our repair and calibration facility, for a nominal charge.**

The recommended calibration interval for this instrument is 12 months and begins on the date of receipt by the customer. For recalibration, please use our calibration services. Refer to our repair and calibration section at [www.aemc.com/calibration](http://www.aemc.com/calibration).

**Serial #:** \_\_\_\_\_

**Catalog #:** 2130.03

**Model #:** 1060

Please fill in the appropriate date as indicated:

Date Received: \_\_\_\_\_

Date Calibration Due: \_\_\_\_\_





 


Chauvin Arnoux<sup>®</sup>, Inc.  
d.b.a AEMC<sup>®</sup> Instruments  
[www.aemc.com](http://www.aemc.com)

---

# TABLE OF CONTENTS

---

<b>1. INTRODUCTION</b> .....	<b>7</b>
1.1 INTERNATIONAL ELECTRICAL SYMBOLS.....	7
1.2 DEFINITION OF MEASUREMENT CATEGORIES .....	8
1.3 RECEIVING YOUR SHIPMENT .....	8
1.4 ORDERING INFORMATION.....	8
1.4.1 Accessories and Replacement Parts.....	9
1.4.2 Accessory Information.....	9
<b>2. PRODUCT FEATURES</b> .....	<b>10</b>
2.1 CONTROL FEATURES .....	12
2.2 DIGITAL DISPLAY FEATURES.....	13
2.3 BARGRAPH .....	13
2.4 SYMBOLS .....	14
2.5 BUTTON FUNCTIONS.....	15
2.5.1 2nd Button.....	15
2.5.2 V-TIME /  Button .....	15
2.5.3 R-DAR-PI / R(t) Button .....	16
2.5.4  / ALARM Button .....	18
2.5.5  / SMOOTH Button.....	19
2.5.6  Button .....	20
2.5.7 SET-UP Button (Configuring the Instrument).....	20
2.5.8 Clearing the Memory .....	22
2.5.9 Communication Rate (RS-232) .....	22
2.5.10 Lead Resistance Compensation.....	22
2.5.11 Default Device Configuration .....	23
2.5.12 Blocking (Disabling) Test Voltages .....	23
2.6 MEASUREMENT FUNCTIONS.....	23
2.6.1 AC/DC Voltage.....	23
2.6.2 Insulation Measurement .....	24
2.6.3 Continuity ( $40 \Omega$  ) / Resistance (400 k $\Omega$ ) .....	25

**3. SPECIFICATIONS .....26**

- 3.1 REFERENCE CONDITIONS ..... 26
- 3.2 VOLTAGE ..... 26
- 3.3 INSULATION RESISTANCE ..... 26
- 3.4 CONTINUITY ..... 30
- 3.5 RESISTANCE ..... 30
- 3.6 POWER SUPPLY ..... 31
- 3.7 MECHANICAL SPECIFICATIONS ..... 31
- 3.8 ENVIRONMENTAL SPECIFICATIONS ..... 32
- 3.9 SAFETY SPECIFICATIONS ..... 32

**4. OPERATION .....33**

- 4.1 MEASUREMENT PROCEDURE ..... 33
- 4.2 INSULATION MEASUREMENT (SEE § 2.6.2) ..... 33
- 4.3 CONTINUITY MEASUREMENT (SEE § 2.6.3)..... 34
- 4.4 RESISTANCE MEASUREMENT (SEE § 2.6.3)..... 34
- 4.5 CAPACITANCE MEASUREMENT ..... 34

**5. MEMORY / RS-232 (MODEL 1060) .....35**

- 5.1 RS-232 SPECIFICATIONS ..... 35
- 5.2 SAVING / RECALLING VALUES (MEM/MR BUTTON) ..... 35
- 5.3 PRINTING MEASURED VALUES (PRINT/PRINT MEM  
BUTTON - MODEL 1060) ..... 37
- 5.4 INSTANTANEOUS PRINTING OF MEASUREMENTS (PRINT  
BUTTON) ..... 38
- 5.5 PRINTING DATA IN MEMORY (PRINT MEM BUTTON)..... 39

**6. APPLICATION EXAMPLES .....41**

- 6.1 INSULATION MEASUREMENTS ON ELECTRICAL  
INSTALLATIONS ..... 41
- 6.2 MEASUREMENTS ON ELECTRICAL OR TELECOM  
CABLE ..... 41
- 6.3 INSULATION MEASUREMENTS ON MOTORS ..... 42

**7. USING DATAVIEW® ..... 43**

- 7.1 INSTALLING DATAVIEW® ..... 43
- 7.2 MEGOHMMETER CONTROL PANEL ..... 45

**8. MAINTENANCE .....46**

- 8.1 BATTERY REPLACEMENT (MODEL 1050)..... 46
- 8.2 RECHARGING THE BATTERY (MODEL 1060)..... 46
- 8.3 FUSE REPLACEMENT ..... 47
- 8.4 CLEANING ..... 47
- 8.5 STORAGE ..... 47
- 8.6 REPAIR AND CALIBRATION ..... 48
- 8.7 TECHNICAL ASSISTANCE ..... 48
- 8.8 LIMITED WARRANTY ..... 49
  - 8.8.1 Warranty Repairs ..... 49

---

# 1. INTRODUCTION






---

## **WARNING**

These safety warnings are provided to ensure the safety of personnel and proper operation of the instrument.

- Do not attempt to perform any tests with these instruments until you have read the instruction manual.
- Safety is the responsibility of the operator!
- Tests are to be carried out only on non-energized circuits! Check for live circuits before making resistance measurements (safety check).
- High voltage is present, as is the sample connected to it. Anyone performing or assisting in testing must follow all safety precautions to prevent electrical shock to themselves and to others.
- Use personal protective equipment where appropriate.
- When testing samples with a capacitive component, make sure they have been properly discharged and are safe to touch. Dielectric insulation samples should be short-circuited for at least five times the amount of time they were energized.
- Megohmmeters should never be used in an explosive environment.
- Use the leads supplied with the megohmmeters. If they are defective or worn, replace before testing.
- The Model 1060 does not allow measurements to be carried out during battery charging.
- This instrument can be used on installations rated for 600 V, CAT III.

### 1.1 INTERNATIONAL ELECTRICAL SYMBOLS

	Signifies that the instrument is protected by double or reinforced insulation.
	<b>CAUTION - Risk of Danger!</b> Indicates a <b>WARNING</b> . Whenever this symbol is present, the operator must refer to the user manual before operation.
	Indicates a risk of electric shock. The voltage at the parts marked with this symbol may be dangerous.
	This product complies with the Low Voltage & Electromagnetic Compatibility European directives.
	In the European Union, this product is subject to a separate collection system for recycling electrical and electronic components in accordance with directive WEEE 2012/19/EU.

## 1.2 DEFINITION OF MEASUREMENT CATEGORIES

- CAT IV:** Corresponds to measurements performed at primary electrical supply (< 1000 V).  
*Example: primary overcurrent protection devices, ripple control units, and meters.*
- CAT III:** Corresponds to measurements performed in the building installation at the distribution level.  
*Example: hardwired equipment in fixed installation and circuit breakers.*
- CAT II:** Corresponds to measurements performed on circuits directly connected to the electrical distribution system.  
*Example: measurements on household appliances and portable tools.*

## 1.3 RECEIVING YOUR SHIPMENT

Upon receiving your shipment, make sure that the contents are consistent with the packing list. Notify your distributor of any missing items. If the equipment appears to be damaged, file a claim immediately with the carrier and notify your distributor at once, giving a detailed description of any damage. Save the damaged packing container to substantiate your claim.



**NOTE:** Charge the instrument fully before use (Model 1060).



---

## 1.4 ORDERING INFORMATION

**Megohmmeter Model 1050 (Discontinued) ..... Cat. #2130.01**  
**(No Longer Available For Purchase - Replaced by Model 1060)**

*Includes detachable accessory pouch (one red, one blue test lead, one black shielded lead, three color-coded (black, red and blue) alligator clips, one black test probe), batteries, spare fuses and a user manual.*

**Megohmmeter Model 1060 ..... Cat. #2130.03**

*Includes detachable accessory pouch (one red, one blue test lead, one black shielded lead, three color-coded (black, red and blue) alligator clips, one black test probe; one RS-232 DB9 F/F 6 ft null modem cable, RS-232 to USB adapter, US 115 V power cord, spare fuses, rechargeable battery, and a USB stick with DataView® software and a user manual.*



**NOTE:** Spare fuse and clip are located inside the instrument's case.



## 1.4.1 Accessories and Replacement Parts

Remote Test Probe.....	<b>Cat. #2118.97</b>
Cable, PC RS-232, DB9 F/F 6 ft Null Modem Cable (1060).....	<b>Cat. #2119.45</b>
Fuse, Set of (3), 0.1 A, 660 V .....	<b>Cat. #2119.56</b>
Fuse, Set of (1), 2.5 A, 1200 V .....	<b>Cat. #2119.57</b>
Lead, Replacement Set (1 red, 1 blue test lead, 1 black shielded lead, 3 color-coded alligator clips, 1 black test probe, no RS cable).....	<b>Cat. #2119.58</b>
Inverter – 12 VDC to 120 VAC 200 W for Vehicle use.....	<b>Cat. #2135.43</b>
Lead, Set of (3) Color-coded 10 ft Safety Leads .....	<b>Cat. #2951.70</b>
Replacement 9.6 V Rechargeable Battery Pack (1060).....	<b>Cat. #2960.21</b>
US 115 V Power Cord .....	<b>Cat. #5000.14</b>
Adapter – RS-232 to USB 2.0 (1060).....	<b>Cat. #5000.60</b>

**Order Accessories and Replacement Parts Directly Online**  
Check our Storefront at [www.aemc.com/store](http://www.aemc.com/store) for availability

## 1.4.2 Accessory Information

### Remote Test Probe

- The yellow test button generates the test voltage when pressed.
- The push-button on the back of the probe allows you to light the test point (approx 500 lux of light). This function is very useful, since insulation testing is performed on de-energized installations, which can be in a dark area.

### DataView® Software (Model 1060)

- Retrieve data from memory and plot graphs of the changes in insulation as a function of the time over which the test voltage is applied, R(t).
- Print out protocols of personalized tests (depending on the user's needs).
- Create text files for use on spreadsheets.

---

## 2. PRODUCT FEATURES

---

The Megohmmeters Models 1050 and Model 1060 are portable instruments housed in rugged casing.

The Model 1050 uses 1.5 V (C cell) alkaline batteries.

The Model 1060 uses a rechargeable battery and AC power.

**Model 1060: Measurements cannot be performed during battery charging.**

These megohmmeters are designed to check the safety of electrical installations and equipment.

### Units Measure:

- Voltage
- Insulation Resistance
- Continuity
- Resistance
- Capacitance


### Advantages:

- Digital filtering of insulation measurements
- Measuring with the remote control probe
- Automatic voltage measurement in all functions
- Automatic detection of external AC or DC voltages on the terminals
- Threshold programming in each function, triggering audible alarms
- Timed control of measurement duration
- Fuse protection, with defective fuse detection and indication
- Automatic discharge of residual high voltage on the tested device
- Automatic shut-off to save the batteries
- Battery level indicator (1050) or battery charge status indicator (1060)
- Large easy-to-read back-lit LCD


### Additional Features (Model 1060 only):

- Integral rechargeable battery
- 128 kB memory, real-time clock and serial interface
- Control and programming of the instrument from a PC (with DataView® software)

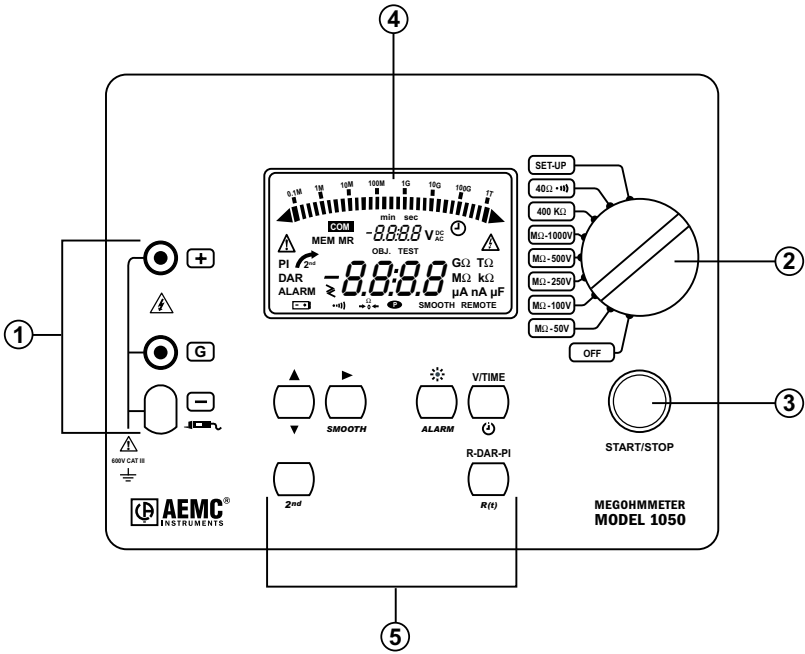


 

# MODEL 1050

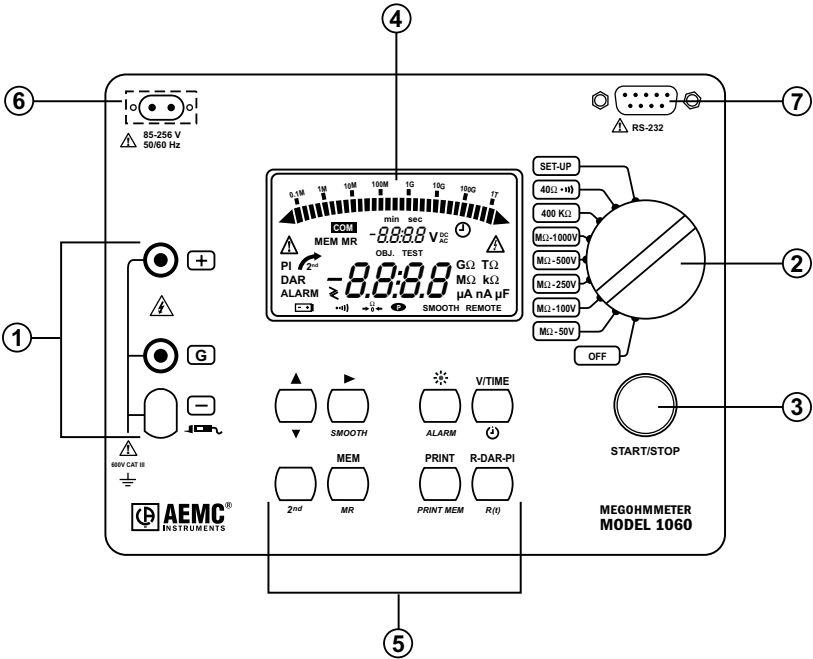

# MODEL 1060



## 2.1 CONTROL FEATURES

1. Safety terminals: +, **G** and -.  
Next to the - terminal, there are 2 additional terminal contacts for the remote control probe connection (3 contact connector).
2. Rotary selector switch with 9 positions:
  - **OFF** - Instrument is off
  - **MΩ - 50 V** - Insulation measurement (2 kΩ to 200 GΩ)
  - **MΩ - 100 V** - Insulation measurement (4 kΩ to 400 GΩ)
  - **MΩ - 250 V** - Insulation measurement (10 kΩ to 1 TΩ)
  - **MΩ - 500 V** - Insulation measurement (20 kΩ to 2 TΩ)
  - **MΩ - 1000 V** - Insulation measurement (40 kΩ to 4 TΩ)
  - **400 KΩ** - Resistance measurement
  - **40 Ω**  - Continuity measurement
  - **SET-UP** - Set-up of the megohmmeter
3. START/STOP button
4. Back-lit liquid crystal display
5. 6 buttons (1050) or 8 buttons (1060), each with a first and second function. The second functions are highlighted in yellow below each button:
  - **2nd** - Selects the second function on each button
  - **R-DAR-PI** - Lets you choose the type of measurement to be performed. Instantaneous Resistance (R), Dielectric Absorption (DAR), or Polarization Index (PI).
  - **R(t)** - Show/hide the interval values of insulation resistance, test voltage and time-stamping, following a time-controlled test.
  - **V/TIME** - When measuring insulation, pressing this button displays the time elapsed since the beginning of the measurement, then the exact voltage generated. When performing resistance or capacitance measurement, this button has no effect. In MR (memory recall), it displays the date and time at which the measurement was stored, the exact test voltage and the OBJ : TEST number.
  -  - Activates or deactivates the **time-controlled** test mode
  -  - Turns the display backlight ON or OFF
  - **ALARM** - Activates or deactivates the alarms programmed in SET-UP
  -  - Selects a parameter to be modified
  - **SMOOTH** - Stops/Starts smoothing of displayed values during insulation testing
  -  - Increases the flashing parameter being displayed. To move about the list of interval insulation measurements, in the R(t) function.

- ▼ - Decreases the flashing parameter being displayed. To move about the list of interval insulation measurements in the R(t) function.


If the ▲ and ▼ buttons are held down, the movement between parameters is increased to a faster rate.

*Model 1060 only:*

- **MEM** - Saves measured values
- **MR** - Recalls saved data
- **PRINT** - Prints measurement results
- **PRINT MEM** - Prints memory contents

6. RS-232 serial interface male plug (9-pin) for connection to a PC.

## 2.2 DIGITAL DISPLAY FEATURES

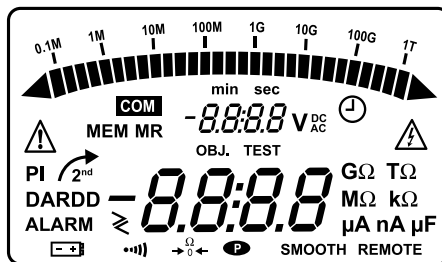

**Main Display Indicates:**

- Insulation measurement (resistance, DAR and PI, capacitance)
- Continuity measurement
- Resistance measurement

**Small Display Indicates:**

- Voltage measured or applied by the instrument
- Elapsed time or the output voltage, during insulation measurement

After recording data (1060), the small display also indicates the time and date in MR (memory recall) mode, and the memory address with the OBJ : TEST number.

## 2.3 BARGRAPH

- Active during insulation measurement (0.1 MΩ to 1 TΩ).
- Indicates the battery charge at start-up.
- Indicates free memory space - one segment representing approximately 100 groups of saved values, with each group holding approximately 50 recordings (1 OBJ and 1 TEST).

## 2.4 SYMBOLS

**MEM/MR:** Memory address (1060) - the number is displayed on the small digital display.

**OBJ:TEST:** Memory address (1060) - the number is displayed on the small digital display.

**COM:** Flashes on the screen when data is transmitted to the serial interface (1060) or remains permanently displayed if there is a problem during transfer.

**DAR/PI:** Indicates the mode chosen before insulation measurement or the results of these measurements.



Dangerous voltage generated;  $V > 120 \text{ V}$ .



External voltage present, symbol is activated after pressing START, if  $V > 25 \text{ VAC} \pm 3 \text{ V}$  or  $> 35 \text{ VDC}$ .



Activation of **time-controlled test** mode or clock adjustment when in SET-UP (1060).



Indicates that the second function of a button is to be used.



Flashes if the battery voltage is low, indicating that the batteries should be replaced or recharged (See § 8). The voltage is displayed on the small display for 2 seconds when the instrument is turned on. The main display indicates **bat** when the test is carried on.



Signal that lead compensation is in effect.



Warning buzzer is activated.



Indicates that the Auto Power OFF function has been deactivated.

**SMOOTH:** Smooths the insulation measurements displayed.






**REMOTE:** Remote control via an interface (1060). In this mode, all the buttons and the rotary switch on the instrument are non-functional, except for the OFF position.

**FUSE HI:** Flashes if the **+** input fuse is defective.

**FUSE -G-:** Flashes if the **G** input fuse is defective.

## 2.5 BUTTON FUNCTIONS

### 2.5.1 2nd Button

- Selects the second function (highlighted in yellow) on the buttons.
- The  symbol appears. This symbol disappears upon pressing the function button chosen, except if the  button is activated. In this case, it only disappears when the  button is pressed again, or if other function buttons are pressed. This allows you to rapidly decrease parameters with the  button, without having to press the  button every time.

### 2.5.2 V-TIME / Button

#### *First Function - V/TIME*

Displays all the secondary information available on the small display.

#### **For Insulation Measurement:**


- The time elapsed since the start of the measurement
- The voltage between the instrument's + and – terminals
- Date, time, test voltage and OBJ:TEST number in memory recall mode (MR)

#### **For Resistance or Continuity Measurement:**

- Voltage between the instrument's + and – terminals
- Date, time, test voltage and OBJ:TEST number in memory recall mode (MR)

#### *Second Function - Time-controlled Test*

Displays the measurement duration programmed in **SET-UP** on the small display.

- The  symbol lights up.
- Pressing the **START** button begins the measurement process. The measurement duration is set to 15 minutes by default.
- As soon as the measurement starts, the small display counts down the remaining duration of the measurement. Once it reaches zero, the measurement stops.
- As the time-controlled test is carried out, interval samples (resistance/voltage values as a function of time) are automatically saved. The time between each sample is set to 30s by default, but it can be changed in the **SET-UP** menu.
- The samples are displayed with the **R(t)** function (see § 2.5.3) as long as a new measurement has not been started. With each new measurement, the previous sample value is erased from the memory. These sample values are saved with the last value of the resistance if used with the **MEM** (memory storage) function.



**NOTE:** If the selector switch's position is altered, or if the STOP button is pressed during measurement, the measurement is interrupted.

This function is only active for insulation measurement.

---

## 2.5.3 R-DAR-PI / R(t) Button

### First Function - R-DAR-PI

The **R-DAR-PI** button allows automatic measurement of:

- Polarization Index (PI)
- Dielectric Absorption Ratio (DAR)

These two parameters are useful on long cables, or when monitoring the aging of insulation on electrical machines.

On this material, measurement is adversely affected at the beginning, due to interfering currents (from capacitive charges, dielectric absorption) which eventually cancel each other out. Therefore, in order to get an accurate measurement of the leakage current, it is necessary to carry out the measurement over a long period of time, to reduce the influence of any interfering currents at the beginning of the measurement.

Next we calculate the **PI** or the **DAR** ratios:

$$PI = R_{10 \text{ min}} / R_{1 \text{ min}} \text{ (2 values to record during a 10 min measurement)}$$

$$DAR = R_{1 \text{ min}} / R_{30 \text{ s}} \text{ (2 values to record during a 1 min measurement)}$$

The quality of insulation depends on the results found.

DAR	PI	State of the insulation
< 1.25	< 1	Inadequate, even dangerous
	< 2	
< 1.6	> 2 to < 4	Good
> 1.6	> 4	Excellent


### Using the R-DAR-PI Function:

During or after measurement, the **R-DAR-PI** button allows you to scroll through the following values:

- DAR (for measurements lasting >1 min).
- PI (for measurements lasting >10 min).
- Capacitance in  $\mu\text{F}$  (only after the measurement has stopped and the circuit has been discharged).
- Insulation resistance in  $\text{M}\Omega$ ,  $\text{G}\Omega$  or  $\text{T}\Omega$ .

### Automatic Measurement of DAR or PI:

- If the button is pressed when in voltage measurement mode before proceeding with a measurement, the following is displayed:

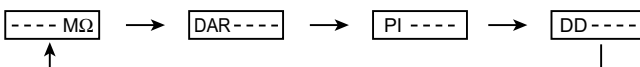




Depending on the choices (DAR or PI), the measurement goes as follows:

- a) **DAR:** Press **START** - the **DAR** symbol flashes and the display indicates - - - - as long as the calculation of the coefficient is not possible ( $t < 1$  mn).




After 1 min, the measurement stops and the main display automatically shows the DAR value. During or after measurement, the **R-DAR-PI** button can be used to see the insulation measurement carried out, but it does not give the PI value since the measurement has not lasted long enough.

- b) **PI:** Press **START** - the **PI** symbol flashes and the display indicates - - - - as long as the calculation of the coefficient is not possible ( $t < 10$  mn).

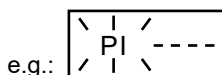

After 10 minutes, the measurement stops and the main display automatically shows the PI value. During and after measurement, the **R-DAR-PI** button makes it possible to display the DAR (after 1 min), the PI (after 10 min) and the insulation measurement.

**Note:** If during DAR or PI measurement (automatic or not), a high external interference voltage becomes present, or the insulation resistance goes beyond the device's measurement range, then the DAR or PI measurements are interrupted and the screen indicates:

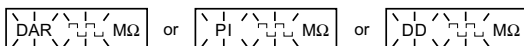

**Note:** The 10 min / 1 min measurement durations for PI calculation can be modified in the **SET-UP** menu (see § 2.5.7), allowing changes to standards or to suit a particular application.

### **Second Function - R(t)**

Used to access the interval insulation resistance values as a function of time after a measurement in **time-controlled test** mode (see § 2.5.2).

The time between each saved sample is programmed in the **SET-UP** menu.

This function is also available on the Model 1050, which has neither a read-write memory for saving measured data, nor an interface for data retrieval from the instrument by a PC.

#### **Model 1050:**

Up to 20 samples can be recorded during measurement at the sample rate chosen in **SET-UP** (the default value is 30 seconds). It is possible to save more than 20 samples depending on available memory.


### Model 1060:

The number of samples that can be saved is only limited by the memory space available.

To enter the display mode, press the **R(t)** button:

- The small display indicates the time 00:30 (e.g. the sampling frequency is every 30 s).
- The main display shows the corresponding R value.

Use the **V/TIME** button to alternate between the voltage and time (on the small display), associated with the R value on the main display.

The  button is used to scroll down through the all the samples saved during measurement, allowing you to read the information in order to draw R(t) and V(t) graphs.

This makes it possible to carry out R(t) analysis on-site, without a printer or a PC.

To exit this function, press the **R(t)** or **R-DAR-PI** button again.

### 2.5.4 / ALARM Button

#### **First Function** -

Turns the display back-light **ON** or **OFF**.

#### **Second Function** - **ALARM**

Activates/deactivates the ALARM function. The **ALARM** symbol is displayed when activated.

If activated, and the high or low threshold values are programmed, the **ALARM** symbol flashes and the buzzer (if activated) sounds continuously when the threshold is crossed.

It is possible to program a different limit in each function. These limits will be stored in memory even after the device is turned off.

### **Activating the Alarm Indication before a Test**

To activate the Alarm Indication before performing a test you must go through the following steps:

- Program the Alarm Set Point Resistance Value for the Test Voltage you will be using.
- Turn the Rotary switch to the Setup position.
- Press the Yellow 2<sup>nd</sup> button and then the Alarm button to set Alarms. The first time you press 2<sup>nd</sup> & Alarm you will see the alarm setting for 50 volt tests.
- Press 2<sup>nd</sup> & Alarm buttons repeatedly until you see the test you wish to set alarms for in the top line of the display. The sequencing will be 50, 100, 250, 500, 1000, Res and Cont.

- Use the cursor keys to adjust the Blinking value. First select KΩ, MΩ, GΩ or TΩ using the Up Arrow Key (▲).
- Next, press the Right Arrow Key (▶) to move to the next selection which is the greater than (>) / less than (<) choice. Use the ▲ to make your selection.
- Press the ▶ again to move to the Resistance Value Set Point Selection. You can change this value digit by digit using the ▲ / ◀ combination working from the highest to lowest digit.
- When finished programming the alarm settings, place the rotary switch to the desired test function.
- Before initiating a test, press the Yellow 2<sup>nd</sup> button and the Alarm button to activate the Alarm Notification. The word **ALARM** will appear in the lower left side of the display.
- Next, press the round yellow Start/Stop button to begin the test. The Alarm symbol will flash and the buzzer will sound continuously if the Alarm set point is tripped.



**NOTE:** If the rotary switch is turned off prior to the next test, the alarm notification will be deactivated. You will need to press the Yellow 2<sup>nd</sup> button and the Alarm button to activate the Alarm Notification when you turn the unit back on before starting the next test, if alarm notification is desired.

---

## 2.5.5 ▶ / SMOOTH Button

### **First Function - ▶**

Selects the desired parameter to be modified - the selected parameter flashes.

It is modified using the ▲ button (see § 2.5.6).

### **Second Function - SMOOTH**

Activates a digital filter for insulation measurement. It only has an effect on the displayed values (which are smoothed) and not the actual measurements.

For example, this function is useful when the displayed insulation values are highly unstable, brought about due to a capacitive component in the tested element.

## 2.5.6 ▲▼ Button

Changes the flashing parameters displayed, or views R(t) values (see § 2.5.3).

As a general rule, two figures (day, month, hour, min., sec., and OBJ:TEST) flash.

The ▲ and ▼ functions have a **follow-on** mode. (e.g. as soon as the high or low program limit is reached, the parameter to be modified switches automatically to the following low or high limit.)

### First Function ▲

- Press button briefly to increase the displayed number slowly
- Press button for a longer time to increase at a faster rate

### Second Function ▼

- Press button briefly to decrease the displayed number slowly
- Press button for a longer time to decrease at a faster rate

Unlike all the second functions of other buttons, it is not necessary to press the ↷<sub>2<sup>nd</sup></sub> button each time to get to the ▼ function. The ↷<sub>2<sup>nd</sup></sub> symbol remains displayed and is valid for the ▼ function (only), as long as the user does not deactivate it by pressing ↷<sub>2<sup>nd</sup></sub> or another button.

## 2.5.7 SET-UP Button (Configuring the Instrument)




After selecting **SET-UP** with the rotary selector switch:

- All the display segments are lit up for 1 second
- The software version number is displayed
- The instrument serial number is displayed
- **PUSH** comes up on the small display and **btn** on the main display, inviting the operator to press a button

**The SET-UP function is used to directly access the parameters to be programmed, by pressing the corresponding button:**

- After having pressed a button, the corresponding figures or symbols appear on the screen
- The figures or the symbols that can be modified flash on the screen
- Use the ► and ▲▼ buttons
- All the parameters are immediately and permanently saved

The table below defines the buttons that are functional when in SET-UP, and the corresponding display with the possible range of adjustment.

Parameter program	Command Button	Display			
		main	small	symbol	value
Duration of <b>time-controlled test</b>			15 : 00	min : sec	1-59 min
1st and 2nd times for PI calculation	R-DAR-PI	second time (10 min)	first time (1 min)	min : sec	00 : 59
Time between interval samples in <b>time-controlled test</b>	R(t)		00 : 30	min : sec	5 s - 59 min
Limit for M $\Omega$ - 50 V	ALARM	50 k $\Omega$	50 V	ALARM <	2 k-200 G and < / >
Limit for M $\Omega$ - 100 V	ALARM (2nd press)	100 k $\Omega$	100 V	ALARM <	4 k-400 G and < / >
Limit for M $\Omega$ - 250 V	ALARM (3rd press)	250 k $\Omega$	250 V	ALARM <	10 k - 1 T and < / >
Limit for M $\Omega$ - 500 V	ALARM (4th press)	500 k $\Omega$	500 V	ALARM <	20 k - 2 T and < / >
Limit for M $\Omega$ - 1000 V	ALARM (5th press)	1000 k $\Omega$	1000 V	ALARM <	40 k - 4 T and < / >
Limit for 400 k $\Omega$ (resistance measurement)	ALARM (6th press)	100 k $\Omega$	rES	ALARM <	0.01-400 k $\Omega$ and < / >
Limit for 40 $\Omega$ (continuity measurement)	ALARM (7th press)	2 $\Omega$	Cont	ALARM <	0.01-40 $\Omega$ and < / >
Time	V/TIME		12 :55		hh (0-23) mn (0-59)
Date (European version)	V/TIME (2nd press)	17.03	1999		jj.mm.aaaa
Version : USA, European	V/TIME (3rd press)	USA/Euro			USA/Euro
Clear Memory	MEM then MEM (2s)	cLr	ALL	MEM	
Selective clearing of memory	MEM then  and  and MEM (2s)	cLr	OBJ : TEST number	MEM + OBJ : TEST	00...99
Baud	PRINT	9600	bAUd		300...9600
Buzzer		On			ON / OFF
Auto Power OFF	 (2nd press)	On			ON / OFF
Compensation	 (3rd press) then  and START	--- (value if START)	On	$\Omega$ → 0 ←	ON / OFF and 0.01-5 $\Omega$
Default configuration	 (4th press) then START	DFLt	SEt		
Disabling test voltages	 (5th press)	On	50 V		ON / OFF
Disabling test voltages	 (6th press)	On	100 V		ON / OFF
Disabling test voltages	 (7th press)	On	250 V		ON / OFF
Disabling test voltages	 (8th press)	On	500 V		ON / OFF
Disabling test voltages	 (9th press)	On	1000 V		ON / OFF

The values shown on this table, in the **Display/main** and **Display/small** columns, are the factory default values. In case they are accidentally changed, it is possible to get them back (see § 2.5.11).

## 2.5.8 Clearing the Memory

In **SET-UP**, press the **MEM** button:

- The **MEM** symbol flashes
- The small display indicates **ALL**
- The main display indicates **CLR**

To clear the entire memory, press the **MEM** button again for 2 seconds:

- The **MEM** symbol is displayed without flashing
- The main display indicates **FrEE**

To clear the contents of a specific **OBJ : TEST** number:

- Select the number using the **▶** and **◆** buttons
- **CLr** remains displayed on the main display


Press the **MEM** button again for 2 seconds to clear the contents:

- The small display indicates the **OBJ : TEST** number
- The main display indicates **FrEE**

## 2.5.9 Communication Rate (RS-232)

- In **SET-UP**, press the **PRINT** button.
- The main display indicates the Communication Rate (300, 600, 1200, 2400, 4800, 9600 or Parallel).
- **baud** appears on the small display. The value can be changed using the **▲** and **▼** buttons.
- **Parallel** appearing in the display means that the parallel mode has been selected. This is for printing on a parallel printer.

## 2.5.10 Lead Resistance Compensation

In **SET-UP**, press the  button three times. The  $\rightarrow 0 \leftarrow$  symbol and **ON** appears in the small display. **OFF** can be selected with the **◆** button. In this instance, the lead resistance will not be subtracted during continuity measurement.

To store the lead resistance:


- Connect them together and press **START** (in **SET-UP** position  $\rightarrow 0 \leftarrow$ )
- The resistance of the leads will be stored and indicated on the main display

**NOTE:**

- This value is stored in memory, even when the instrument is switched **OFF**.
- The lead compensation only comes into effect when performing continuity measurements.
- To activate/deactivate this function, simply select **ON** or **OFF** on the small display with the **◆** button.

- The value will be stored and displayed on the main display, but can be activated or deactivated, depending on what the small display indicates.
- Values between (0 and 5)  $\Omega$  can be saved for lead compensation. Beyond this value, nothing is saved.

## 2.5.11 Default Device Configuration


In **SET-UP**, press the  button four times:



- **SET** appears in the small display
- **DFLt** appears in the main display

Press **START** to select the default configuration settings (see the previous table).

## 2.5.12 Blocking (Disabling) Test Voltages

This function prevents insulation measurements from being carried out at selected test voltages. This makes it possible to use the instrument for specific applications and avoid improper voltages.

In **SET-UP**, press the  button 5 times or more (depending on the voltage to be disabled):

- The test voltages appear in order on the small display with the  symbol and **ON/OFF** on the main display.
- Choose **ON** or **OFF** using the  button for each test voltage you wish to disable (OFF) or to reinstate (ON) for use during insulation tests at these voltages.

## 2.6 MEASUREMENT FUNCTIONS

### 2.6.1 AC/DC Voltage

- Select any measurement position with the rotary selector switch.
- The instrument is automatically in AC/DC voltage measurement mode.
- The voltage is continuously measured and is shown on the small display.




**Measurement is prohibited if an external voltage is present at the terminals before pressing START/STOP.** Similarly, if an interference voltage is detected during measurement, the measurement is stopped and that voltage is indicated.

---

## 2.6.2 Insulation Measurement

As soon as one of the  $M\Omega$  positions has been selected, the main display shows - - -  $M\Omega$ , and the small display indicates the voltage present at the device's + and - terminals.





**If the external voltage present at the device's terminals exceeds 25 V<sub>AC/DC</sub>**, pressing the yellow **START/STOP** button does not bring about insulation measurement, but instead triggers an audible signal. The  symbol flashes for 2 seconds, then the device goes back to automatic voltage measurement.

---

If the external voltage present at the device terminals is below 25 V<sub>AC/DC</sub>, then insulation measurement can proceed.

Pressing **START** immediately begins the measurement. The measurement value is displayed on the main digital display and on the bargraph. An audible beep is given out every 10 seconds to indicate that measurement is in progress.



**If the test voltage is considered to be dangerous (>120 V)**, the  symbol is displayed. If, during insulation measurement, an external voltage >25 V<sub>AC</sub> ±3 V or 35 V<sub>DC</sub> is detected, the measurement is stopped as long as the voltage is applied to the instrument. The  symbol flashes and the voltage value is indicated on the small digital display.

---

If the measurements fluctuate greatly, the **SMOOTH** function can be enabled (see § 2.5.5).

By pressing the **V/TIME** button during measurement, you can alternate between displaying the duration of the voltage measurement and the exact voltage generated on the small display (see § 2.5.2).

Pressing the **STOP** button stops the measurement. After the measurement has been stopped the result remains displayed.

It is possible to scroll through all the other results available on the main display using the **R-DAR-PI** button. This button can also be used before the measurement is begun (see § 2.5.3).

If the **time-controlled test** mode has been selected, the **R(t)** button makes it possible to access all the saved interval measurements automatically (see § 2.5.2 and 2.5.3).

If the **ALARM** function is activated, a buzzer is triggered as soon as the measurement crosses the threshold programmed in the **SET-UP** configuration menu (see § 2.5.4).



## Display of values after measurement

The following information may be displayed:

R-DAR-PI Button	V-TIME Button	
Main Display	Small display	Small display if the MR button is pressed (Model 1060)
<b>Resistance</b> DAR PI	duration (min. sec) duration (min. sec) duration (min. sec)	date, time, test voltage, OBJ : TEST date, time, test voltage, OBJ : TEST date, time, test voltage, OBJ : TEST
<b>Capacitance*</b> R(t)	duration (min. sec)	last voltage

\*Capacitance ( $\mu F$ ) measurement is only displayed after the measurement is finished and the circuit has been discharged.

### 2.6.3 Continuity (40 $\Omega$ $\bullet\bullet\bullet$ ) / Resistance (400 k $\Omega$ )

- Continuity measurement is carried out on the 40  $\Omega$  switch position (with a test current >200 mA up to 20  $\Omega$ )
- Resistance measurement is carried out on the 400 k $\Omega$  position (with a test current <6 mA).

Once the selector switch has been turned to one of these 2 function positions, the main display indicates - - - -  $\Omega$  (for continuity) or - - - - k $\Omega$  (for resistance) and the small display indicates the voltage present on the + and – terminals.



**If the voltage is >3 V<sub>AC</sub>/DC and the START/STOP button is pressed, the  $\bullet\bullet\bullet$  symbol flashes and the audible alarm beeps (for 2 seconds) signaling that the measurement was denied. The instrument then goes back to its normal voltage measurement.**

**If the voltage is <3 V<sub>AC</sub> and the START/STOP button is pressed, the measurement proceeds.**

The main display indicates the continuity or resistance value in progress, while the small display indicates the voltage present on the + and – terminals.

The **R-DAR-PI**, **V/TIME** and **SMOOTH** buttons are not active for these functions.



**WARNING:** If, during continuity or resistance measurement, an external voltage >25 V<sub>AC</sub>  $\pm$ 3 V or 35 V<sub>DC</sub> is detected, the measurement is stopped as long as the voltage is applied to the instrument.

The  $\triangle$  symbol flashes and the voltage value is indicated on the small digital display.

If the **ALARM** function is activated, a buzzer is triggered as soon as the measurement crosses the threshold programmed in the **SET-UP** configuration menu.

---

## 3. SPECIFICATIONS

---

### 3.1 REFERENCE CONDITIONS

Influence Quantity	Reference Values
Temperature	23 °C ± 3 K
Relative Humidity	(45 to 55) %
Supply Voltage	(9 to 12) V
Frequency Range	DC and (15.3 to 65) Hz
Capacitance in parallel with the input resistance	0μF
Electric Field	nil
Magnetic Field	< 40 A/m

### 3.2 VOLTAGE

**Measuring Range:** (1 to 99.9) V; (100 to 1000) V

**Resolution:** 0.1 V; 1 V

**Frequency Range:** DC/(16 to 65) Hz (65 Hz to 420 Hz not specified)

**Accuracy:** ±1 % of Reading ± 3 V, AC sinusoidal or DC voltage (DC and 15.3 Hz to 65 Hz)

**Input Resistance:** 750 kΩ approx



**WARNING:** This instrument is rated 600 V, CAT III, according to EN 61010. NEVER use the megohmmeter on electrical conductors rated above 600 V.

---

### 3.3 INSULATION RESISTANCE

**Method:** Voltage-current method according to EN 61557-2 (ed. 02/97)

**Nominal Output Voltage:** (50, 100, 250, 500, 1000) V<sub>DC</sub>

**Open-circuit Voltage:** ≤1.1 × V<sub>n</sub> ± 5 V (50, 100, 250, 500, 1000) V

**Nominal Current:** >1 mADC at the nominal voltage

**Short-circuit Current:** <6 mADC

**Max. Overvoltage:** V<sub>RMS</sub> max = 1200 V<sub>AC/DC</sub> for 10 seconds between the + and - terminals. 660 V<sub>AC/DC</sub> between the **G** and - or **G** and + terminals.

**Measurement Ranges:** 50 V: 2 kΩ to 200 GΩ  
100 V: 4 kΩ to 400 GΩ  
250 V: 10 kΩ to 1 TΩ  
500 V: 20 kΩ to 2 TΩ  
1000 V: 40 kΩ to 4 TΩ

Range	Res.	Voltage	Accuracy
(2 to 999) k $\Omega$ (1.000 to 3.999) M $\Omega$	1 k $\Omega$	(50, 100, 250, 500, 1000) V	5 % of R $\pm$ 3 cts
(4.00 to 39.99) M $\Omega$	10 k $\Omega$	(50, 100, 250, 500, 1000) V	
(40.0 to 399.9) M $\Omega$	100 k $\Omega$	(50, 100, 250, 500, 1000) V	
(400 to 999) M $\Omega$ (1.000 to 3.999) G $\Omega$	1 M $\Omega$	(50, 100, 250, 500, 1000) V	
(4.00 to 39.99) G $\Omega$	10 M $\Omega$	(50, 100, 250, 500, 1000) V	
(40.0 to 399.9) G $\Omega$	100 M $\Omega$	(50, 100, 250, 500, 1000) V	15 % of R $\pm$ 10 cts
(400 to 999) G $\Omega$ (1.000 to 3.999) T $\Omega$	1 G $\Omega$	(250, 500, 1000) V	

### DC Voltage Measurement (after Insulation Test):


- DC Voltage Range: (25 to 1000) V
- Resolution: 0.5 % VDC
- Accuracy:  $\pm 1$  % of Reading  $\pm$  3 cts
- Voltage vs Load Curve

### Capacitance Measurement (following the discharging of test object):


- Range: (0.005 to 4.999)  $\mu$ F
- Resolution: 1 nF
- Accuracy:  $\pm 10$  %  $\pm$  1 ct

Graphs showing the typical changes in test voltage as a function of the load:


50V Test Voltage

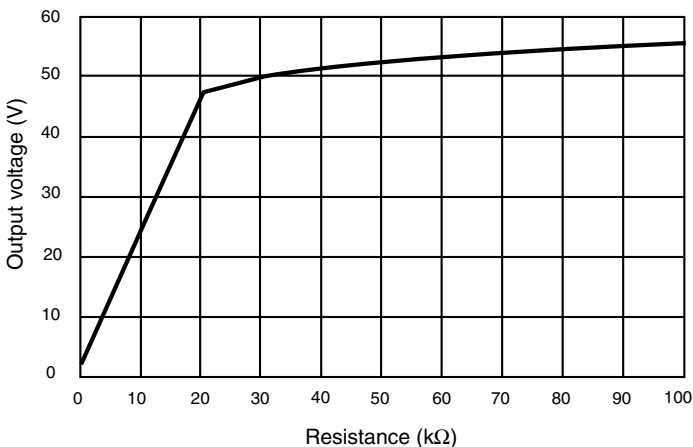


### 100V Test Voltage

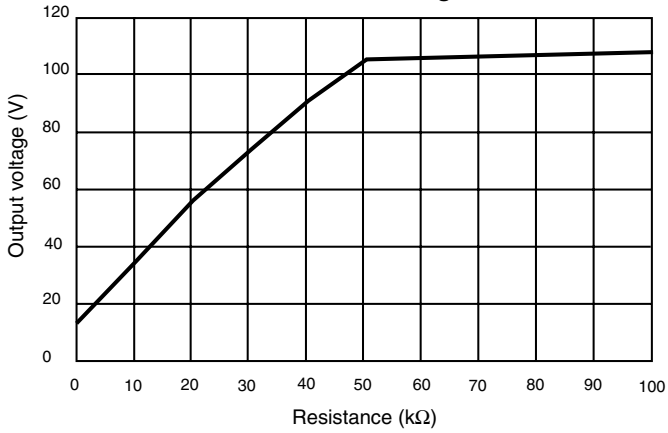

### 250V Test Voltage

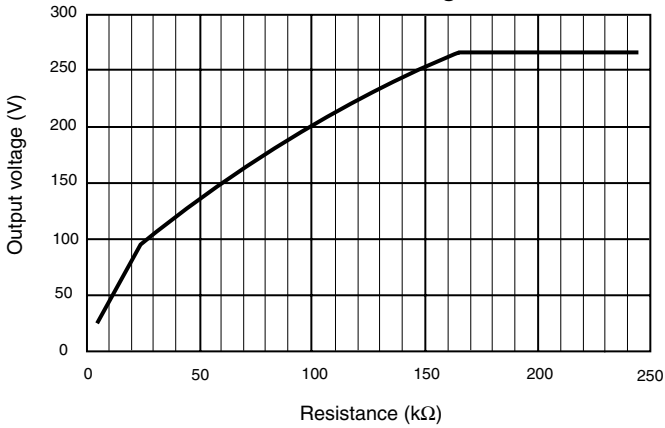

### 500V Range

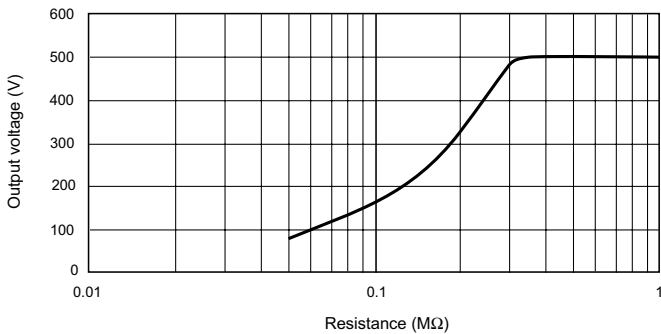

### 1000V Range



#### Typical settling time of the measurement:

	Non-capacitive load	Load with 1 $\mu$ F capacitor
1 M $\Omega$ insulation	7 s	7 s
500 G $\Omega$ insulation	17 s	20 s

These values include the influences on the auto-range and supply voltage regulation system due to the charge of the capacitive component.

#### Discharge time of the tested element (across a 750 k $\Omega$ internal resistance) up to 25 V:

Initial Voltage	Discharge Time
1000 V	2.8 s
500 V	2.2 s
250 V	1.7 s
100 V	1 s
50 V	0.5 s

**Range of DAR and PI Ratios:** 0.000 to 9.999

**Accuracy:**  $\pm 5\%$

### 3.4 CONTINUITY

**Method:** Voltage-current method according to EN 61557-4 (ed. 02/97)

**Open-circuit Voltage:** 12.4 VDC max (< 15 V with external supply)

**Short-circuit Current:** >200 mADC

**Maximum Voltage Surge:**

1200 VAC/DC for 10 seconds between the + and - terminals

660 VAC/DC between the G and - or G and + terminals

**Test Lead Compensation:**

$R_{\Delta}$  is measured for the test leads in short-circuit when in the **SET-UP** menu (see § 2.5.7), this value is stored and subtracted from all continuity measurements. The compensation is limited to 5  $\Omega$ .

$R$  displayed =  $R$  measured -  $R_{\Delta}$

**Continuity Measurement Range:** (0.01 to 39.99)  $\Omega$

**Resolution:** 0.01  $\Omega$

**Operating Current:**

>200 mA from (0.01 to 20.00)  $\Omega$  and > 140 mA from (20.01 to 39.99)  $\Omega$

**Accuracy:**  $\pm 3\%$   $R \pm 4$  cts

**Maximum Inductive Load:** 5 h without damage to the instrument

**Maximum Serial Mode Voltage:**

3 VAC/DC; measurement is prohibited above this value

### 3.5 RESISTANCE

**Method:** Voltage-current measurement

**Open-circuit Voltage:** Max. 12.4VDC (< 15 V with external supply)

**Short-circuit Current:** <6 mADC

**Max. Voltage Surge:**

1200 VAC/DC for 10 seconds between the + and - terminals

660 VAC/DC between the G and - or G and + terminals

**Max Serial Mode Voltage:**

3 VAC/DC; measurement is prohibited above this value

Range	Resolution	Accuracy
(0.01 to 39.99) $\Omega$	0.01 $\Omega$	$\pm 3\% R \pm 3$ cts
(40.0 to 399.9) $\Omega$	0.1 $\Omega$	
(0.400 to 3.999) k $\Omega$	1 $\Omega$	
(4.00 to 39.99) k $\Omega$	10 $\Omega$	
(40.0 to 399.9) k $\Omega$	100 $\Omega$	

### 3.6 POWER SUPPLY

- 8 x 1.5 V (C cell) alkaline batteries; LR14 (Model 1050)
- Rechargeable battery NiMH (Model 1060)
- Recharge: (85 to 256) V / 50-60 Hz (electrical safety: 256 V, CAT III)

#### Model 1050:

**Measurement:** Average operating time

#### Insulation Measurement:

21,000 x 5 s measurements with 20 s pause, for normal load (1000 V/1 mA)\*

#### Continuity Measurement:

16,000 measurements lasting 5 s with pause of 20 s at nominal load (1000 V/1 mA)\*

*\*Assuming that a 10 minute long PI measurement is made 5 times a day, the operating time will be 67 days (10 weeks or 2.5 months).*

#### Model 1060:

**Measurement:** Average operating time

#### Insulation Measurement:

5000 x 5 s measurements with 29 s pause, for normal load (1000 V/1 mA)\*

#### Continuity Measurement:

4000 measurements lasting 5 s with pause of 20 s at nominal load (1000 V/1 mA)\*

*\*Assuming that a 10 minute long PI measurement is made 5 times a day, the operating time will be 16 days (2.5 weeks or 0.5 months).*

#### Recharging Time (1060)

4.5 hours to reach 100 % of its capacity (max recharge time: 6 h)

0.5 hours to reach 10 % of its capacity (operating radius: 1 day approx)

### 3.7 MECHANICAL SPECIFICATIONS

#### Case Dimensions:

9.45 x 7.28 x 4.33 in (240 x 185 x 110) mm

**Weight:** 7.5 lbs (120 oz)

### 3.8 ENVIRONMENTAL SPECIFICATIONS

**Operating Range:** (14 to 104) °F (-10 to 40) °C during recharging of batteries  
(14 to 131) °F (-10 to 55) °C during measurement  
(20 to 80) % RH

**Nominal Temperature Range:** (32 to 95) °F (0 to 35) °C

**Storage:** (-40 to 158) °F (-40 to 70) °C; (10 to 90) % RH

**Temperature Influence on Measurement Accuracy (all functions):**  
±0.15 % per °C

**Altitude:** <2000 m

### 3.9 SAFETY SPECIFICATIONS

Electrical safety according to EN 61010,  
EN 61557



Double Insulation:

600 V CAT III

Pollution Degree 2

#### **Electromagnetic Compatibility:**

Emission: NF EN 55 081 -1 (June 92)

Immunity: NF EN 55 082 -1 (June 95)

#### **Mechanical Protection:**

IP 54 according to NF EN 60529 (Oct 92)

IK 04 according to NF EN 50102 (June 95)

*\*All specifications are subject to change without notice.*



---

## 4. OPERATION

---



**NOTE:** Charge the instrument fully before use (Model 1060).  
Measurements cannot be performed during battery charging.

---

### 4.1 MEASUREMENT PROCEDURE

- Start the instrument by selecting the corresponding position ( $M\Omega$ ,  $40\ \Omega$   $\bullet\bullet\bullet$ ) or  $400\ k\Omega$ ) with the selector switch. All the segments on the LCD screen are displayed, then the battery (or rechargeable battery) voltage is displayed.
  - Connect the leads to the + and - terminals and the points of measurement.
  - The input voltage is constantly measured and displayed on the small display. If an external voltage is present that is greater than the thresholds described in § 4.2, 4.3 and 4.4, then measurement is prohibited.
  - Press the **START/STOP** button to start the measurement.
  - Press **START/STOP** again to stop the measurement. The last result remains on the display until the next measurement is started, or the selector switch is turned.
- 



**WARNING:** If a voltage  $>25\ V_{AC}$  or  $35\ V_{DC}$  is detected during measurements, the instrument indicates this voltage on the small display, the warning symbol flashes and the measurement is stopped.

---

**Note:** There are several special functions that can be used (see § 2.5).

### 4.2 INSULATION MEASUREMENT (SEE § 2.6.2)

This function allows the instrument to measure insulation resistance from  $1\ k\Omega$  to  $40\ G\Omega$  at a test voltage of (50, 100, 250) V and up to  $1\ T\Omega$  at 500 V and 1000 V.

- Use the rotary switch to select the required test voltage ( $M\Omega$ -50 V, or  $M\Omega$ -100 V, or  $M\Omega$ -500 V, or  $M\Omega$ -1000 V).
  - Connect the instrument to the insulator to be tested.
  - Start the measurement using the **START/STOP** button and read the results.
- 



**WARNING:** If the voltage present exceeds 8 V for  $M\Omega$ -50 V, 16 V for  $M\Omega$ -100 V, or 25 V at all the other test voltages, then measurement is prohibited.

---

Scroll through the results on the main display with the **R-DAR-PI** button, or on the small display with the **V/TIME** button.

Use **R(t)** when carrying out a 'time-controlled test' to scroll through the interval measurement values saved at the sampling rate specified in **SET-UP**.

These values are available until another measurement is taken or the selector switch is turned.

---

**When measuring high levels of insulation** ( $> 1 \text{ G}\Omega$ ), it is advised that the guard terminal be used to eliminate the influence of surface leakage currents. The guard is connected between the two measurement contact points, and the surface susceptible to surface currents, (e.g. dusty, damp cable or transformer insulation). In this case, alligator clips are preferable to test-probes held in the hand.

As soon as insulation measurement is stopped, the test circuit is automatically discharged using the instrument's internal resistance.

### 4.3 CONTINUITY MEASUREMENT (SEE § 2.6.3)

The measurement current is  $> 200\text{mA}$  from  $0\Omega$  to  $20\Omega$  and  $> 140\text{mA}$  from  $20\Omega$  to  $40\Omega$  in this function.

This measurement serves to test the low resistance. The measurement ranges increase automatically up to  $40\Omega$  with a maximum resolution of  $0.01\Omega$ .

- Select the  $40\Omega$  position with rotary switch.
- Connect the instrument to the test object.
- If the voltage present is  $> 3\text{V}$ , then measurement is prohibited.
- Start the measurement and read the results.

**NOTE:** It is possible to compensate for the lead resistance (see § 2.5.10)



**NOTE:** The R-DAR-PI and V/TIME buttons are not active for this function. There is no automatic polarity change in continuity measurement.

---

### 4.4 RESISTANCE MEASUREMENT (SEE § 2.6.3)

The measurement current is limited to  $6 \text{ mA}$  in this function. The measurement ranges increase automatically up to  $400 \text{ k}\Omega$  with maximum resolution of  $0.01 \Omega$ .

- Select  $400\text{k}\Omega$  position with the rotary switch.
- Connect the instrument to the test object.
- If the voltage present is  $> 3 \text{ V}$ , then measurement is prohibited.
- Start the measurement and read the results.

During measurement, the potential difference at the input is indicated on the small display (useful for measurement of multi-junction components: thyristors, high voltage diodes, etc).

The open circuit voltage is equal to the voltage of the instrument's battery.



**NOTE:** The R-DAR-PI and V/TIME buttons are not active for this function.

---

### 4.5 CAPACITANCE MEASUREMENT

Capacitance measurement is automatically carried out during insulation measurement. It is displayed after the measurement is stopped and the circuit is discharged, using the **R-DAR-PI** button.

---

## 5. MEMORY / RS-232 (MODEL 1060)

---

### 5.1 RS-232 SPECIFICATIONS


The Communication Rate, for DataView® software connection, can be set to 300, 600, 1200, 2400, 4800, 9600.

This setting is carried out in the **SET-UP** menu (see § 2.5.7).

Data format: 8 data bits, 1 stop bit, no parity, Xon / Xoff protocol.

#### Connection to a PC:

Cable, PC RS-232, DB9 F/F 6 ft Null Modem Cable (1060)..... **Cat. #2119.45**

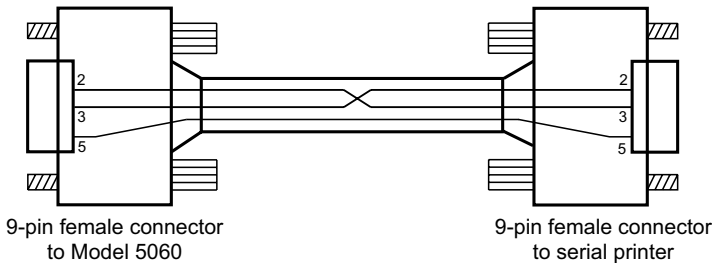

### 5.2 SAVING / RECALLING VALUES (MEM/MR BUTTON)

**NOTE:** After replacing or completely discharging the battery, the message **Memory OFF** appears when you try to save a measurement in memory.

**To be able to save your measurements, you will need to do the following:**

Set the instrument to **SET-UP** and press the **MEM** button (the display shows **MEM All clr**). Press the **MEM** button for 2 s (the display shows **MEM ALL FrEE**). Measurements are now ready to be saved.

#### **First Function - MEM (Save)**

Results can be recorded in the instrument's memory and stored along with addresses defined by an object number (OBJ) and a test number (TEST).

An object represents a **box** into which we can place 99 tests. Thus, an object can represent a machine or an installation upon which a certain number of measurements (insulation, resistance and continuity) are carried out.

- 1) When the button is pressed, the **MEM** symbol flashes and the small display indicates the first free **OBJ : TEST** number (e.g. 02 : 01). The main display indicates "**FrEE**".
  - The **OBJ** number is the same as that of the last saved measurement, and the **TEST** number goes up in increments of 1.
  - It is always possible to modify **OBJ : TEST** with ► and ◄.
  - If the user happens to select a memory address that is already occupied, then **OCC** appears on the main screen.
  - If a new **OBJ** is selected, the **TEST** goes back to 01.
- 2) By pressing **MEM** once again, the present measurement results will be recorded in the selected memory address (occupied or otherwise). The **MEM** symbol stops flashing and remains displayed. The time and the date of this recording are stored with the available data (R, V, t).
 

**If a button other than MEM is pressed, or the selector switch is moved before pressing MEM a second time, the instrument exits from MEM mode without saving the results.**
- 3) If a time-controlled test has been initiated, interval values (samples) are available. They are automatically saved under the same **OBJ : TEST** number as the final measurement.

### Memory Capacity:

- Total memory space: 128 kb
- Data management: 8 kb
- Free memory space: 120 kb

An insulation measurement result takes up approximately 80 bytes. For a **time-controlled test**, a sample takes up 10 more bytes. A resistance or continuity measurement takes up 26 bytes. Therefore, it is possible to record about 1500 insulation measurements or about 4000 resistance or continuity tests.

### Free Memory Space

This function is automatically activated when a result is saved.

Press **MEM** once to get the following free **OBJ : TEST** number; the bargraph displayed corresponds to the available free memory space.

- If the entire memory is free, all of the bargraph segments appear.
- If the entire memory is full, the arrow to the left of the bargraph flashes.
- As soon as the storage is complete, the bargraph disappears.

Each segment of the bargraph equals approximately 50 recordings.

## Second Function - MR

The **MR** function allows a recall of any saved data from memory, regardless of the position of the rotary selector switch.

- When the button is pressed, the **MR** symbol is displayed. The small display indicates the last OBJ : TEST number to be assigned (e.g. 02 :11).
- 02 11 flashes opposite the **TEST** symbol. Use the ► and ⬆ buttons to select the desired OBJ : TEST number.
- If a new OBJ is selected, TEST is automatically set to the maximum stored number. At this stage it is possible to review the entire memory with the ► and ⬆ buttons, since the measurement values corresponding to the selected OBJ : TEST number are displayed on the main display. Use the **R-DAR-PI** button to scroll through them.
- The **V/TIME** button gives access to the date/time/V/OBJ-TEST number for each result.
- If the recording selected by the OBJ : TEST number corresponds to a time-controlled test, the R(t) values can be accessed by pressing the **R(t)** button. The small display changes and indicates min:sec (time of 1st sample) and the symbol ⌚ flashes on the screen. You can scroll through the other samples with the ⬆ button.

**To exit from R(t) mode** and return to the normal memory recall mode (OBJ : TEST), press **R(t)** or **R-DAR-PI** again. **To exit the MR function**, press the **MR** button once again or turn the selector switch.

## 5.3 PRINTING MEASURED VALUES (PRINT/PRINT MEM BUTTON - MODEL 1060)

**NOTE:** AEMC suggests that printing be performed through the DataView software vs. the PRINT Button.

However, if you use a serial printer, choose the appropriate communication speed (communication rate) in the **SET-UP** menu, between 300 and 9600, then program the printer to the format run by the instrument (see § 5.1).

If you are using a parallel printer, you should set the communication rate to **Parallel** when in **SET-UP** and use the optional serial-to-parallel adapter.

There are two printing modes possible:

- Instantaneous printing of measurement (PRINT)
- Printing of recorded data (PRINT memory)



**If the data transmission to the printer is successful**, the COM symbol flashes once on the screen. **If a problem has occurred**, the COM symbol remains on the LCD screen without flashing.

---

## 5.4 INSTANTANEOUS PRINTING OF MEASUREMENTS (PRINT BUTTON)

Following a measurement or after accessing values in **MR** mode, use the **PRINT** function to print the measurement results.



**NOTE:** PRINT only works when the test is stopped by pressing the START/STOP button and the value is displayed on the LCD.

---

Press the **PRINT** button to print the following:

- 1 set of measurements (V/R/DAR/PI/date/time) for normal tests.
- The R(t) values if the **time-controlled test** has been used.

**To stop printing**, move the position of the selector switch.

According to the function used, the following models are obtained:

### Insulation Measurement

AEMC® Instruments Model 1060

Instrument number: 000 001

INSULATION RESISTANCE TEST

OBJECT: 01 ..... TEST: 01     *(only printed in MR mode)*

Description: .....

.....

Date: .....03.31.2001

Start time: .....14 :55

Test duration: ..... 15 min 30 sec

Temperature: ..... °C ..... °F

Relative humidity: ..... %

Test voltage: ..... 1000 V

Insulation resistance (R):.....385 GOhm

DAR (R 1 ft/R 30 in): .....1.234

PI (R 10 ft/R 1 in): .....2.345

Comments: .....

.....

Date of next test: ...../.../.....

*After a time-controlled test other results are printed (interval samples):*

Time	Resistance	Voltage
00 : 30	35.94 GOhm	1005 V
01 : 00	42.00 GOhm	1005 V
01 : 30	43.50 GOhm	1005 V
etc...		

*A space for the operator's signature is available at the end of the printout.*

## Continuity or Resistance Measurement

AEMC® Instruments Model 1060

Instrument number: 000 001

CONTINUITY TEST or RESISTANCE TEST

OBJECT: 01 ..... TEST: 01 (only printed in MR mode)

Description:.....

Date: .....03.31.2001

Start time: .....14 : 55

Test current: ..... > 200 mA

Lead compensation: .....0.12  $\Omega$

Potential difference: .....0.9 V

Continuity or Resistance: .....0.45  $\Omega$

Comments: .....

Date of next test: ...../.../.....

*A space for the operator's signature is available at the end of the printout.*

## 5.5 PRINTING DATA IN MEMORY (PRINT MEM BUTTON)

Prints out the contents of the instrument's read-write memory.

The small display indicates 01 : 01 for the OBJ : TEST number (starting address of printing).

The main display indicates the last recording in memory (the end address of printing). e.g. 12 : 06.

01 flashes opposite the OBJ position, the usual selection procedure should be used (▶ and ◀ buttons) in order to define the start/end addresses of the printout.

- **To exit without printing**, alter the position of the selector switch.
- **To proceed with printing**, press the **PRINT** button once more.
- **To stop printing**, alter the position of the selector switch.

Only the main results are printed out.

Example :

AEMC® Instruments Model 1060

Instrument number: 000 001

### CONTINUITY TEST

OBJECT: 01 ..... TEST: 01

Date: .....03.31.2001

Start time: .....14:55

Continuity: .....0.45  $\Omega$

**CONTINUITY TEST**

OBJECT: 01 ..... TEST: 02  
Date: .....03.31.2001  
Start time: .....14:55  
Continuity: .....0.91 Ω

**INSULATION RESISTANCE TEST**

OBJECT: 01 ..... TEST: 03  
Date: .....03.31.2001  
Start time: .....14:55  
Test duration: ..... 15 min 30 sec  
Temperature: ..... °C ..... °F  
Relative humidity: ..... %  
Test voltage: ..... 1000 V  
Insulation resistance (IR): ..... 385 GΩ  
DAR (RI 1 ft/30 in): .....1.234  
PI (RI 10 ft/RI 1 ft): .....2.345  
Comments: .....  
.....  
.....

*A space for the operator's signature is available at the end of the printout.*




---

## 6. APPLICATION EXAMPLES


---

### 6.1 INSULATION MEASUREMENTS ON ELECTRICAL INSTALLATIONS

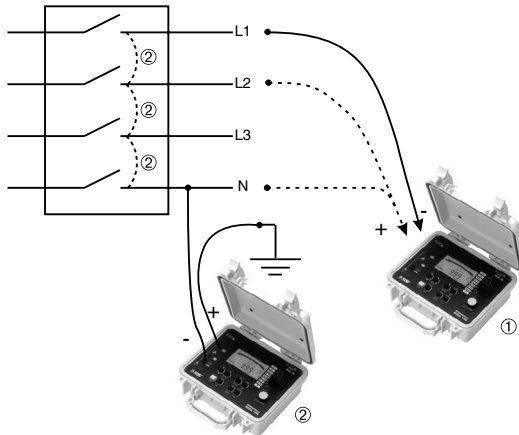


The measurements are performed between conductors ① or between all the conductors and the earth ②.

### 6.2 MEASUREMENTS ON ELECTRICAL OR TELECOM CABLE

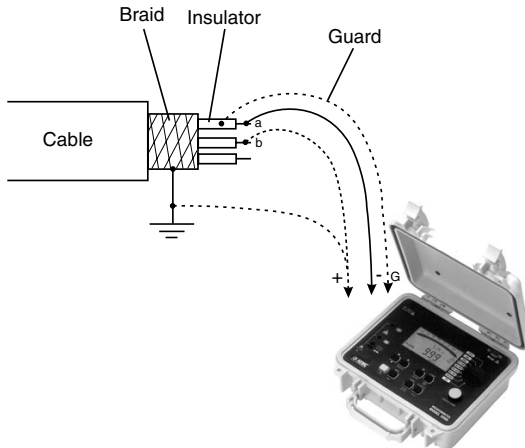

Insulation between wires or between each wire and the earth.

### 6.3 INSULATION MEASUREMENTS ON MOTORS

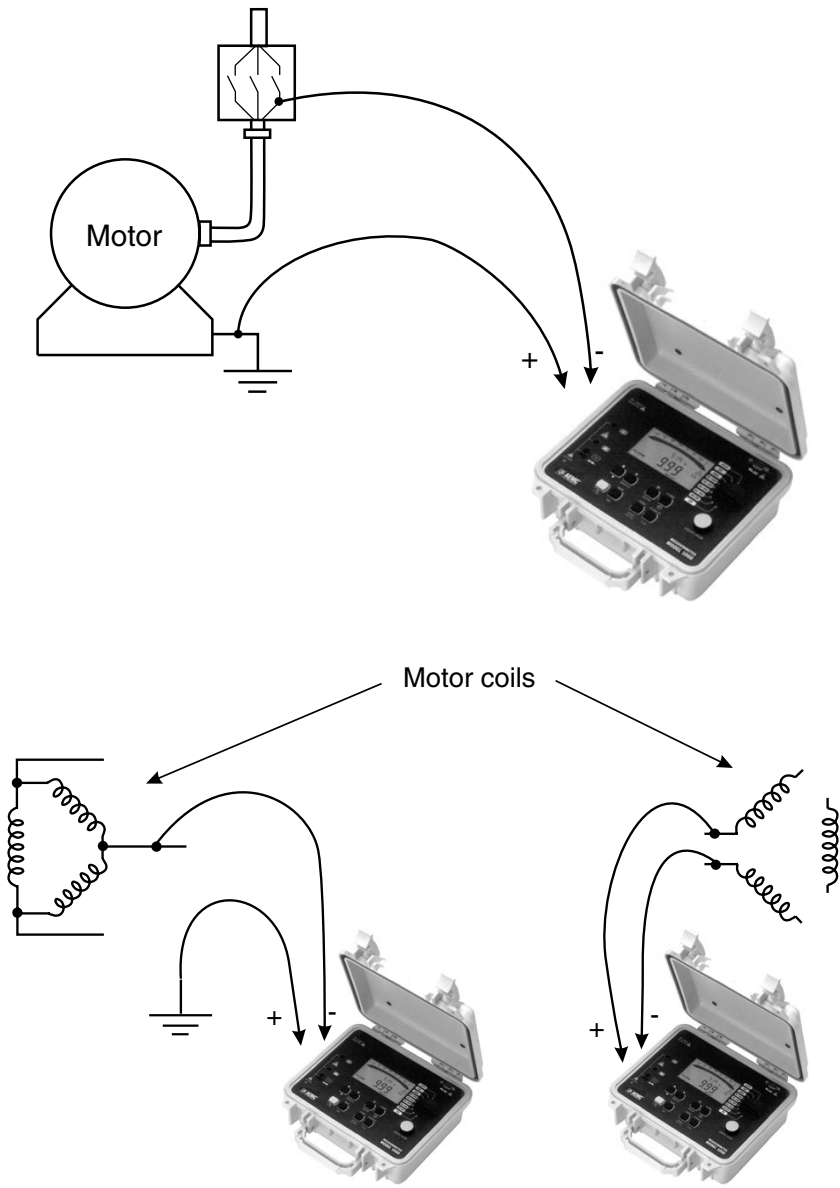

# 7. USING DATAVIEW®


## 7.1 INSTALLING DATAVIEW®



**DO NOT CONNECT THE INSTRUMENT TO THE PC BEFORE INSTALLING THE SOFTWARE AND DRIVERS.**

**NOTE:** When installing, the user must have Administrative access rights during the installation. The users access rights can be changed after the installation is complete.

1. Insert the DataView thumb drive into an available USB port on your computer. If Autorun is enabled, an AutoPlay window appears on your screen. Click **Open folder to view files** to display the DataView folder. If Autorun is not enabled or allowed, use Windows Explorer to locate and open the USB drive labeled **DataView**.
2. When the DataView folder is open, find the file Setup.exe located in the root directory of the USB drive, and double-click it to run the installation program.
3. The DataView setup screen appears.

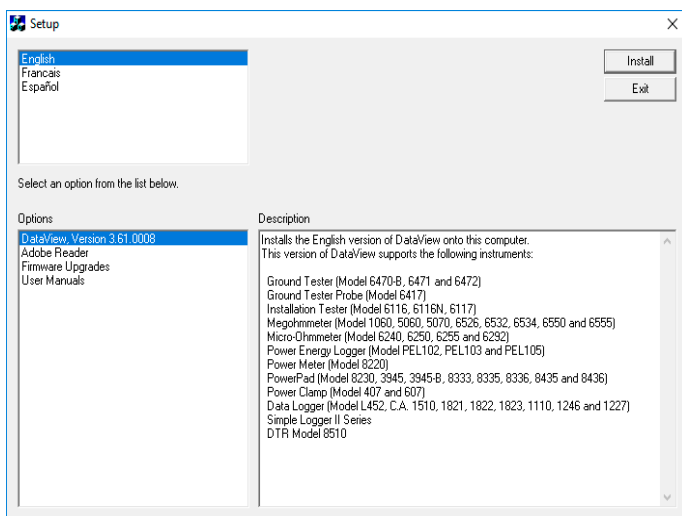


In the upper left corner of the screen, choose the language version of the Setup interface. (All Setup screens and dialogs will immediately appear in the selected language.)

In the lower left corner are the available installation options. In addition to the DataView software, you can select **Adobe Reader**. This links to the Adobe web site where you can download the latest version of Reader. This program is required to view DataView .pdf documents. The option Firmware Upgrades links to the website where you can check for new firmware updates for the instrument. Finally, User Manuals displays a list of .pdf files contained in the USB drive that accompanies DataView. (DataView also comes with a Help system that is installed with the program files.)

To install DataView, select DataView in the Options list and click Install.

4. Select the language version of DataView you want to install (English, French, or Spanish) then click Next. (By default, the language selected in step 3 is highlighted.)

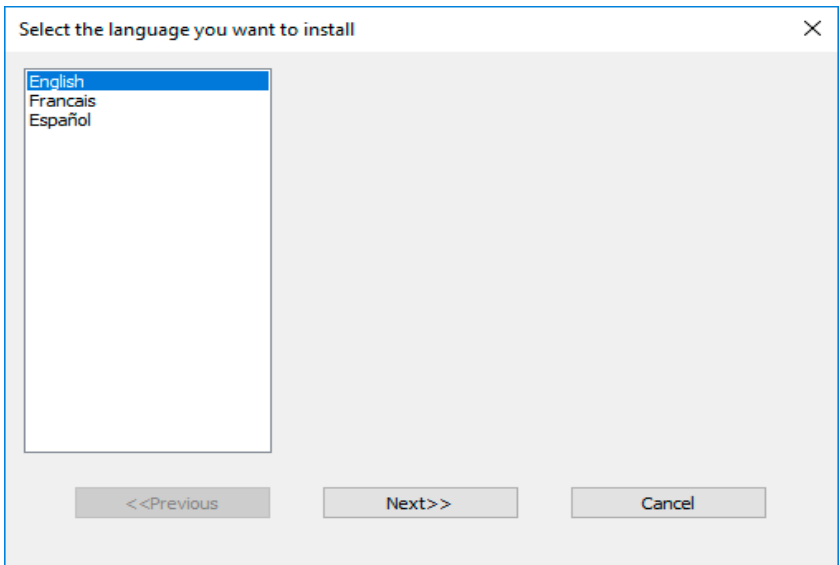

5. You are now prompted to select the software you want to install. Each AEMC® Instruments product family has its own specially designed Control Panel. If you are performing a Complete install, by default all available Control Panels are selected (a check mark next to the Control Panel indicates it is selected). Control Panels take up disk space on the computer; so unless you have other types of AEMC® Instruments devices, we recommend that you select Megohmmeter and deselect the rest. You should also check the option DataView Core, which is a requirement if you plan to create DataView reports.


After you finish selecting and deselecting Control Panels and/or DataView Core, click Next.

6. The Setup program now informs you that it is ready to install DataView. If you want to review any of your previous selections, click the Previous button to return to earlier screens. Otherwise, click Install to begin installation.
7. The InstallShield program installs the selected software. If an earlier version of the software is already installed on your computer, for each selected program the InstallShield program will:
  - (a) Ask you to confirm the installation of the program. Click Next.
  - (b) Display a status bar indicating the progress of the installation.
  - (c) Inform you when the program is installed.

Click Finish to install the next selected program.

If the software is not installed (or if the installed software is the same version as the selected software), the software is installed without requesting confirmation.

When all programs are installed, a message appears informing you of this. Click Finish to return to the Setup screen

8. You can now select additional Setup options to install (see step 3 above). When finished, click Exit.
9. The DataView folder now appears on your computer desktop, within which is the Megohmmeter  icon and the icon(s) for any other Control Panel(s) you have installed.

## 7.2 MEGOHMMETER CONTROL PANEL

Clicking the DataView icon in the DataView folder on your desktop opens the core DataView program. Clicking the Megohmmeter Control Panel icon opens the Megohmmeter Control Panel.

In general, core DataView features are for creating, viewing, editing, and storing DataView reports; while the Control Panel is for connecting to, configuring, viewing measurements on, and downloading data from the instrument. You can access all DataView features through either the DataView icon or the Control Panel icon. For users who interact with megohmmeter instruments, we recommend primarily using the Control Panel. However, there are situations where using the core DataView icon may be more convenient for some users, such as when viewing multiple archived reports from different AEMC® Instruments product families.

For further information about using the Megohmmeter Control Panel, consult the Help system that comes with the product. Access this Help by clicking the option Help in the Control Panel's menu bar at the top of the screen.

---


## 8. MAINTENANCE

---

Use only factory specified replacement parts. AEMC® Instruments will not be held responsible for any accident, incident, or malfunction following a repair done other than by its service center or by an approved repair center.

### 8.1 BATTERY REPLACEMENT (MODEL 1050)

The battery voltage is displayed on the small digital display for 2 seconds when switching on the instrument. The main display indicates **bAt**.

Before any measurements, make sure that the  symbol is not displayed when a measurement function is selected. If it is displayed, change all the batteries.



**NOTE:** Make sure that none of the terminals are connected and that the switch is set to OFF before opening the battery compartment.

---

Batteries specified: LR14 alkaline (C cell)

 
1. Unscrew the 4 screws on the underside of the case to open the instrument.
2. Place the instrument on a table and press on the screws to extract the front panel.
3. Turn the instrument over to remove the front panel unit from the case. The batteries are then accessible at the back of the panel unit.
4. Unscrew the two screws on the battery compartment.
5. Replace cover before operating the instrument.



**NOTE:** Make sure that the seal is not damaged during the removal and replacement of the front panel.

---

### 8.2 RECHARGING THE BATTERY (MODEL 1060)

If the  symbol is flashing, then it is necessary to recharge the battery.

Connect the instrument to the 120 VAC power cord via the connector, charging starts automatically:

- **bAt** on the small display and **CHrG** on the main display, signifies fast charging in progress.
- **bAt** on the small display and **CHrG** flashing on the main display, signifies slow charging (starts off with fast charge, temperature conditions permitting).
- **bAt** on the small display and **FULL** on the main display, signifies that charging is over.

If the instrument is started up and the battery voltage is > 8 V, then the normal use of the device is permitted.



**NOTE:** The battery should be changed by an authorized repair facility recognized by AEMC® Instruments.

Changing the battery causes data to be lost from the memory.

---

Press the **MEM/MR** button. **OFF** is displayed. Proceed with a total clearing of memory in SET-UP (see § 2.5.7) so the MEM/MR functions can be used again.

### 8.3 FUSE REPLACEMENT

If **FUS HI** or **FUSE -G-** flashes on the LCD when turning the instrument ON, or during continuity measurement, then it is imperative that the corresponding fuses be changed, taking all the necessary precautions when opening up the instrument (see § 8.1 for opening procedure).



**NOTE:** Make sure that none of the terminals are connected and that the selector switch is set to OFF before opening up the case.

---

Using only the types of fuses shown on the sticker in battery compartment:

- **+** terminal fuse F1 (FUS HI): F 2.5 A fast fuse - 1.2 kV - 8 x 50 mm - 15 kA
- **G** terminal fuse F2 (FUS G): F 0.1 A fast fuse - 660 V - 6.3 x 32 mm - 20 kA

### 8.4 CLEANING



**Disconnect the instrument from any source of electricity.**

Use a soft cloth lightly dampened with soapy water. Rinse with a wet cloth and then dry with a dry cloth. Do not use alcohol, solvents or hydrocarbons.

### 8.5 STORAGE

If the instrument is not used for an extended time period (longer than two months), remove the battery and store separately (Model 1050).

## 8.6 REPAIR AND CALIBRATION

To ensure that your instrument meets factory specifications, we recommend that it be sent back to our factory Service Center at one-year intervals for recalibration or as required by other standards or internal procedures.

### For instrument repair and calibration:

You must contact our Service Center for a Customer Service Authorization Number (CSA#). Send an email to [repair@aemc.com](mailto:repair@aemc.com) requesting a CSA#, you will be provided a CSA Form and other required paperwork along with the next steps to complete the request. Then return the instrument along with the signed CSA Form. This will ensure that when your instrument arrives, it will be tracked and processed promptly. Please write the CSA# on the outside of the shipping container. If the instrument is returned for calibration, we need to know if you want a standard calibration or a calibration traceable to N.I.S.T. (includes calibration certificate plus recorded calibration data).

**Ship To:** Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive ▪ Dover, NH 03820 USA  
Phone: (800) 945-2362 (Ext. 360) / (603) 749-6434 (Ext. 360)  
Fax: (603) 742-2346  
E-mail: [repair@aemc.com](mailto:repair@aemc.com)

### (Or contact your authorized distributor.)

Contact us for the costs for repair, standard calibration, and calibration traceable to N.I.S.T.



**NOTE:** You must obtain a CSA# before returning any instrument.

---

## 8.7 TECHNICAL ASSISTANCE

If you are experiencing any technical problems or require any assistance with the proper operation or application of your instrument, please call, e-mail or fax our technical support team:

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
Phone: (800) 343-1391 (Ext. 351)  
Fax: (603) 742-2346  
E-mail: [techsupport@aemc.com](mailto:techsupport@aemc.com) ▪ [www.aemc.com](http://www.aemc.com)



## 8.8 LIMITED WARRANTY

The instrument is warranted to the owner for a period of two years from the date of original purchase against defects in manufacture. This limited warranty is given by AEMC® Instruments, not by the distributor from whom it was purchased. This warranty is void if the unit has been tampered with, abused, or if the defect is related to service not performed by AEMC® Instruments.

**Full warranty coverage and product registration is available on our website at [www.aemc.com/warranty.html](http://www.aemc.com/warranty.html)**

**Please print the online Warranty Coverage Information for your records.**

**What AEMC® Instruments will do:**

If a malfunction occurs within the warranty period, you may return the instrument to us for repair, provided we have your warranty registration information on file or a proof of purchase. AEMC® Instruments will repair or replace the faulty material at our discretion.

**REGISTER ONLINE AT: [www.aemc.com/warranty.html](http://www.aemc.com/warranty.html)**

### 8.8.1 Warranty Repairs

**What you must do to return an Instrument for Warranty Repair:**

First, send an email to [repair@aemc.com](mailto:repair@aemc.com) requesting a Customer Service Authorization Number (CSA#) from our Service Department. You will be provided a CSA Form and other required paperwork along with the next steps to complete the request. Then return the instrument along with the signed CSA Form. Please write the CSA# on the outside of the shipping container. Return the instrument, postage or shipment prepaid to:

Chauvin Arnoux®, Inc. d.b.a. AEMC® Instruments  
15 Faraday Drive, Dover, NH 03820 USA  
Phone: (800) 945-2362 (Ext. 360)  
(603) 749-6434 (Ext. 360)  
Fax: (603) 742-2346 • E-mail: [repair@aemc.com](mailto:repair@aemc.com)

**Caution: To protect yourself against in-transit loss, we recommend that you insure your returned material.**



**NOTE:** You must obtain a CSA# before returning any instrument.

---

**NOTES:**

---

**NOTES:**

---



08/24  
99-MAN 100237 v39

---

**AEMC<sup>®</sup> Instruments**  
15 Faraday Drive • Dover, NH 03820 USA  
Phone: +1 (603) 749-6434 • +1 (800) 343-1391 • Fax: +1 (603) 742-2346  
**[www.aemc.com](http://www.aemc.com)**

---